



## Preliminary Information

### PIT5807A Unwanted Content Theft Alarm Activation

#### Models

| Brand:    | Model:          | Model Years: | VIN: |           | Engine: | Transmissions: |
|-----------|-----------------|--------------|------|-----------|---------|----------------|
|           |                 |              | from | to        |         |                |
| Cadillac  | Escalade Models | 2021         | SOP  | 11/2/2020 | All     | All            |
| Chevrolet | Suburban        | 2021         | SOP  | 11/2/2020 | All     | All            |
| Chevrolet | Tahoe           | 2021         | SOP  | 11/2/2020 | All     | All            |
| GMC       | Yukon Models    | 2021         | SOP  | 11/2/2020 | All     | All            |

|                            |                                                                                                                                                                   |
|----------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Involved Region or Country | North America                                                                                                                                                     |
| Additional Options (RPO)   | With RPO UTV: Vehicle Interior Movement Sensor<br><b>Note: Maybe included in Security Packages such as RPO's UTR and NWM</b>                                      |
| Condition                  | Some customers may comment on the vehicle's content theft alarm (horn and lights) randomly sounding off for no reason. In some cases, there may be DTC B192A set. |
| Cause                      | The cause of this condition could be the B165 Content Theft Deterrent Sensor being too sensitive.                                                                 |

#### Correction:

To correct this concern, reprogram the BCM with the latest calibrations available in Tis2Web. All vehicles built after 11/2/2020 already have the updated BCM calibration and do not require reprogramming. For all vehicles which already have the updated BCM calibration, if you experience this concern please follow normal SI diagnostics.

#### Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Operation | Description                                | Labor Time         |
|-----------------|--------------------------------------------|--------------------|
| 2810215         | Body Control Module Reprogramming with SPS | Use Published Time |

#### Version History

|          |                                                                                                             |
|----------|-------------------------------------------------------------------------------------------------------------|
| Version  | 2                                                                                                           |
| Modified | 01/25/2021 - Created on.<br>08/09/2021 - Add a break point to the models and update the correction section. |



GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.